

Uniform Mitigation Verification Inspection Form

Maintain a copy of this form and any documentation provided with the insurance policy

Inspection Date: <u>08-04-2020</u>		
Owner Information		
Owner Name: Villas II at Heritage Cove Condominium Association		Contact Person:
Address: 14139, 14157, 14163, 14169, 14175 & 14181 Hilton Head Drive		Home Phone:
City: Fort Myers, FL	Zip: 33919	Work Phone:
County: Lee		Cell Phone:
Insurance Company:		Policy #:
Year of Home: Completed in 2003	# of Stories: 1	Email:

NOTE: Any documentation used in validating the compliance or existence of each construction or mitigation attribute must accompany this form. At least one photograph must accompany this form to validate each attribute marked in questions 3 through 7. The insurer may ask additional questions regarding the mitigated feature(s) verified on this form.

1. **Building Code:** Was the structure built in compliance with the Florida Building Code (FBC 2001 or later) OR for homes located in the HVHZ (Miami-Dade or Broward counties), South Florida Building Code (SFBC-94)?

- A. Built in compliance with the FBC: Year Built **2003**. For homes built in 2002/2003 provide a permit application with a date after 3/1/2002: Building Permit Application Date (MM/DD/YYYY) **07 / 16 / 2002**
- B. For the HVHZ Only: Built in compliance with the SFBC-94: Year Built _____. For homes built in 1994, 1995, and 1996 provide a permit application with a date after 9/1/1994: Building Permit Application Date (MM/DD/YYYY) ____/____/_____
- C. Unknown or does not meet the requirements of Answer "A" or "B"

2. **Roof Covering:** Select all roof covering types in use. Provide the permit application date OR FBC/MDC Product Approval number OR Year of Original Installation/Replacement OR indicate that no information was available to verify compliance for each roof covering identified.

Lee County Re-Roof Permit # ROF2018-12428

2.1 Roof Covering Type:	Permit Application Date	FBC or MDC Product Approval #	Year of Original Installation or Replacement	No Information Provided for Compliance
<input checked="" type="checkbox"/> 1. Asphalt/Fiberglass Shingle	09 / 10 / 2018	_____	_____	<input type="checkbox"/>
<input type="checkbox"/> 2. Concrete/Clay Tile	_____/_____/_____	_____	_____	<input type="checkbox"/>
<input type="checkbox"/> 3. Metal	_____/_____/_____	_____	_____	<input type="checkbox"/>
<input type="checkbox"/> 4. Built Up	_____/_____/_____	_____	_____	<input type="checkbox"/>
<input type="checkbox"/> 5. Membrane	_____/_____/_____	_____	_____	<input type="checkbox"/>
<input type="checkbox"/> 6. Other _____	_____/_____/_____	_____	_____	<input type="checkbox"/>

- A. All roof coverings listed above meet the FBC with a FBC or Miami-Dade Product Approval listing current at time of installation OR have a roofing permit application date on or after 3/1/02 OR the roof is original and built in 2004 or later.
- B. All roof coverings have a Miami-Dade Product Approval listing current at time of installation OR (for the HVHZ only) a roofing permit application after 9/1/1994 and before 3/1/2002 OR the roof is original and built in 1997 or later.
- C. One or more roof coverings do not meet the requirements of Answer "A" or "B".
- D. No roof coverings meet the requirements of Answer "A" or "B".

3. **Roof Deck Attachment:** What is the weakest form of roof deck attachment?

- A. Plywood/Oriented strand board (OSB) roof sheathing attached to the roof truss/rafter (spaced a maximum of 24" inches o.c.) by staples or 6d nails spaced at 6" along the edge and 12" in the field. -OR- Batten decking supporting wood shales or wood shingles. -OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that has an equivalent mean uplift less than that required for Options B or C below.
- B. Plywood/OSB roof sheathing with a minimum thickness of 7/16"inch attached to the roof truss/rafter (spaced a maximum of 24"inches o.c.) by 8d common nails spaced a maximum of 12" inches in the field.-OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that is shown to have an equivalent or greater resistance than 8d nails spaced a maximum of 12 inches in the field or has a mean uplift resistance of at least 103 psf.
- C. Plywood/OSB roof sheathing with a minimum thickness of 7/16"inch attached to the roof truss/rafter (spaced a maximum of 24"inches o.c.) by 8d common nails spaced a maximum of 6" inches in the field. -OR- Dimensional lumber/Tongue & Groove decking with a minimum of 2 nails per board (or 1 nail per board if each board is equal to or less than 6 inches in width). -OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that is shown to have an equivalent

Inspectors Initials RD Property Address 14139, 14157, 14163, 14169, 14175 & 14181 Hilton Head Drive

or greater resistance than 8d common nails spaced a maximum of 6 inches in the field or has a mean uplift resistance of at least 182 psf.

- D. Reinforced Concrete Roof Deck.
 - E. Other: _____
 - F. Unknown or unidentified.
 - G. No attic access.
4. **Roof to Wall Attachment:** What is the **WEAKEST** roof to wall connection? (Do not include attachment of hip/valley jacks within 5 feet of the inside or outside corner of the roof in determination of WEAKEST type)
- A. Toe Nails
 - Truss/rafter anchored to top plate of wall using nails driven at an angle through the truss/rafter and attached to the top plate of the wall, or
 - Metal connectors that do not meet the minimal conditions or requirements of B, C, or D

Minimal conditions to qualify for categories B, C, or D. All visible metal connectors are:

- Secured to truss/rafter with a minimum of three (3) nails, **and**
 - Attached to the wall top plate of the wall framing, or embedded in the bond beam, with less than a $\frac{1}{2}$ " gap from the blocking or truss/rafter **and** blocked no more than 1.5" of the truss/rafter, **and** free of visible severe corrosion.
- B. Clips
 - Metal connectors that do not wrap over the top of the truss/rafter, **or**
 - Metal connectors with a minimum of 1 strap that wraps over the top of the truss/rafter and does not meet the nail position requirements of C or D, but is secured with a minimum of 3 nails.
 - C. Single Wraps

Metal connectors consisting of a single strap that wraps over the top of the truss/rafter and is secured with a minimum of 2 nails on the front side and a minimum of 1 nail on the opposing side.
 - D. Double Wraps
 - Metal Connectors consisting of 2 separate straps that are attached to the wall frame, or embedded in the bond beam, on either side of the truss/rafter where each strap wraps over the top of the truss/rafter and is secured with a minimum of 2 nails on the front side, and a minimum of 1 nail on the opposing side, **or**
 - Metal connectors consisting of a single strap that wraps over the top of the truss/rafter, is secured to the wall on both sides, and is secured to the top plate with a minimum of three nails on each side.
 - E. Structural Anchor bolts structurally connected or reinforced concrete roof.
 - F. Other: _____
 - G. Unknown or unidentified
 - H. No attic access

5. **Roof Geometry:** What is the roof shape? (Do not consider roofs of porches or carports that are attached only to the fascia or wall of the host structure over unenclosed space in the determination of roof perimeter or roof area for roof geometry classification).

- A. Hip Roof Hip roof with no other roof shapes greater than 10% of the total roof system perimeter.
Total length of non-hip features: N/A feet; Total roof system perimeter: N/A feet
 - B. Flat Roof Roof on a building with 5 or more units where at least 90% of the main roof area has a roof slope of less than 2:12. Roof area with slope less than 2:12 _____ sq ft; Total roof area _____ sq ft
 - C. Other Roof Any roof that does not qualify as either (A) or (B) above.
6. **Secondary Water Resistance (SWR):** (standard underlays or hot-mopped felts do not qualify as an SWR)
- A. SWR (also called Sealed Roof Deck) Self-adhering polymer modified-bitumen roofing underlayment applied directly to the sheathing or foam adhesive SWR barrier (not foamed-on insulation) applied as a supplemental means to protect the dwelling from water intrusion in the event of roof covering loss.
 - B. No SWR.
 - C. Unknown or undetermined.

Inspectors Initials RD Property Address 14139, 14157, 14163, 14169, 14175 & 14181 Hilton Head Drive

*This verification form is valid for up to five (5) years provided no material changes have been made to the structure or inaccuracies found on the form.

7. **Opening Protection:** What is the weakest form of wind borne debris protection installed on the structure? **First**, use the table to determine the weakest form of protection for each category of opening. **Second**, (a) check one answer below (A, B, C, N, or X) based upon the lowest protection level for ALL Glazed openings **and** (b) check the protection level for all Non-Glazed openings (.1, .2, or .3) as applicable.

Opening Protection Level Chart		Glazed Openings				Non-Glazed Openings	
		Windows or Entry Doors	Garage Doors	Skylights	Glass Block	Entry Doors	Garage Doors
N/A	Not Applicable- there are no openings of this type on the structure		X		X		
A	Verified cyclic pressure & large missile (9-lb for windows doors/4.5 lb for skylights)	X		X		X	X
B	Verified cyclic pressure & large missile (4-8 lb for windows doors/2 lb for skylights)						
C	Verified plywood/OSB meeting Table 1609.1.2 of the FBC 2007						
D	Verified Non-Glazed Entry or Garage doors indicating compliance with ASTM E 330, ANSI/DASMA 108, or PA/TAS 202 for wind pressure resistance						
N	Opening Protection products that appear to be A or B but are not verified						
	Other protective coverings that cannot be identified as A, B, or C						
X	No Windborne Debris Protection						

- A. Exterior Openings Cyclic Pressure and 9-lb Large Missile (4.5 lb for skylights only)** All Glazed openings are protected at a minimum, with impact resistant coverings or products listed as wind borne debris protection devices in the product approval system of the State of Florida or Miami-Dade County and meet the requirements of one of the following for "Cyclic Pressure and Large Missile Impact" (Level A in the table above).

- Miami-Dade County PA 201, 202, and 203
- Florida Building Code Testing Application Standard (TAS) 201, 202, and 203
- American Society for Testing and Materials (ASTM) E 1886 and ASTM E 1996
- Southern Standards Technical Document (SSTD) 12
- For Skylights Only: ASTM E 1886 and ASTM E 1996
- For Garage Doors Only: ANSI/DASMA 115

- A.1 All Non-Glazed openings classified as A in the table above, or no Non-Glazed openings exist
 A.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level B, C, N, or X in the table above
 A.3 One or More Non-Glazed Openings is classified as Level B, C, N, or X in the table above

- B. Exterior Opening Protection- Cyclic Pressure and 4 to 8-lb Large Missile (2-4.5 lb for skylights only)** All Glazed openings are protected, at a minimum, with impact resistant coverings or products listed as windborne debris protection devices in the product approval system of the State of Florida or Miami-Dade County and meet the requirements of one of the following for "Cyclic Pressure and Large Missile Impact" (Level B in the table above):

- ASTM E 1886 and ASTM E 1996 (Large Missile – 4.5 lb.)
- SSTD 12 (Large Missile – 4 lb. to 8 lb.)
- For Skylights Only: ASTM E 1886 and ASTM E 1996 (Large Missile - 2 to 4.5 lb.)

- B.1 All Non-Glazed openings classified as A or B in the table above, or no Non-Glazed openings exist
 B.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level C, N, or X in the table above
 B.3 One or More Non-Glazed openings is classified as Level C, N, or X in the table above

- C. Exterior Opening Protection- Wood Structural Panels meeting FBC 2007** All Glazed openings are covered with plywood/OSB meeting the requirements of Table 1609.1.2 of the FBC 2007 (Level C in the table above).

- C.1 All Non-Glazed openings classified as A, B, or C in the table above, or no Non-Glazed openings exist
 C.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level N or X in the table above
 C.3 One or More Non-Glazed openings is classified as Level N or X in the table above

Inspectors Initials RD Property Address 14139, 14157, 14163, 14169, 14175 & 14181 Hilton Head Drive

*This verification form is valid for up to five (5) years provided no material changes have been made to the structure or inaccuracies found on the form.

- N. Exterior Opening Protection (unverified shutter systems with no documentation)** All Glazed openings are protected with protective coverings not meeting the requirements of Answer "A", "B", or C" or systems that appear to meet Answer "A" or "B" with no documentation of compliance (Level N in the table above).
 - N.1 All Non-Glazed openings classified as Level A, B, C, or N in the table above, or no Non-Glazed openings exist
 - N.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level X in the table above
 - N.3 One or More Non-Glazed openings is classified as Level X in the table above
- X. None or Some Glazed Openings** One or more Glazed openings classified as Level X in the table above.

MITIGATION INSPECTIONS MUST BE CERTIFIED BY A QUALIFIED INSPECTOR.
Section 627.711(2), Florida Statutes, provides a listing of individuals who may sign this form.

Qualified Inspector Name:	License Type:	License or Certificate #:
Richard Verblaauw	Certified General Contractor	CGC1505916
Inspection Company:	Phone:	
R3 of Florida, LLC	239.810.7793	

Qualified Inspector – I hold an active license as a: (check one)

- Home inspector licensed under Section 468.8314, Florida Statutes who has completed the statutory number of hours of hurricane mitigation training approved by the Construction Industry Licensing Board and completion of a proficiency exam.
- Building code inspector certified under Section 468.607, Florida Statutes.
- General, building or residential contractor licensed under Section 489.111, Florida Statutes.
- Professional engineer licensed under Section 471.015, Florida Statutes.
- Professional architect licensed under Section 481.213, Florida Statutes.
- Any other individual or entity recognized by the insurer as possessing the necessary qualifications to properly complete a uniform mitigation verification form pursuant to Section 627.711(2), Florida Statutes.

Individuals other than licensed contractors licensed under Section 489.111, Florida Statutes, or professional engineer licensed under Section 471.015, Florida Statutes, must inspect the structures personally and not through employees or other persons.
Licensees under s.471.015 or s.489.111 may authorize a direct employee who possesses the requisite skill, knowledge, and experience to conduct a mitigation verification inspection.

I, Richard Verblaauw am a qualified inspector and I personally performed the inspection or (*licensed contractors and professional engineers only*) I had my employee (Richard Davis) perform the inspection and I agree to be responsible for his/her work. 

Qualified Inspector Signature: _____ Date: 08-04-2020

An individual or entity who knowingly or through gross negligence provides a false or fraudulent mitigation verification form is subject to investigation by the Florida Division of Insurance Fraud and may be subject to administrative action by the appropriate licensing agency or to criminal prosecution. (Section 627.711(4)-(7), Florida Statutes) The Qualified Inspector who certifies this form shall be directly liable for the misconduct of employees as if the authorized mitigation inspector personally performed the inspection.

Homeowner to complete: I certify that the named Qualified Inspector or his or her employee did perform an inspection of the residence identified on this form and that proof of identification was provided to me or my Authorized Representative.

Signature: _____ Date: 08-04-2020

An individual or entity who knowingly provides or utters a false or fraudulent mitigation verification form with the intent to obtain or receive a discount on an insurance premium to which the individual or entity is not entitled commits a misdemeanor of the first degree. (Section 627.711(7), Florida Statutes)

The definitions on this form are for inspection purposes only and cannot be used to certify any product or construction feature as offering protection from hurricanes.

Inspectors Initials RD Property Address 14139, 14157, 14163, 14169, 14175 & 14181 Hilton Head Drive

*This verification form is valid for up to five (5) years provided no material changes have been made to the structure or inaccuracies found on the form.



R3 of Florida, LLC
P.O. Box 152205
Cape Coral, FL 33915
Office: 239.810.7793
Email: radjrsas@yahoo.com



FRONT ELEVATION VIEW

SIDE ELEVATION VIEW



REAR ELEVATION VIEW

SIDE ELEVATION VIEW


Villas II at Heritage Cove Condominium Association
14139, 14157, 14163, 14169, 14175 & 14181 Hilton Head Drive, Fort Myers, FL 33919
08-04-2020



R3 of Florida, LLC
P.O. Box 152205
Cape Coral, FL 33915
Office: 239.810.7793
Email: radirsas@yahoo.com



ROOF DECK THICKNESS – $\frac{1}{2}$ inch plywood

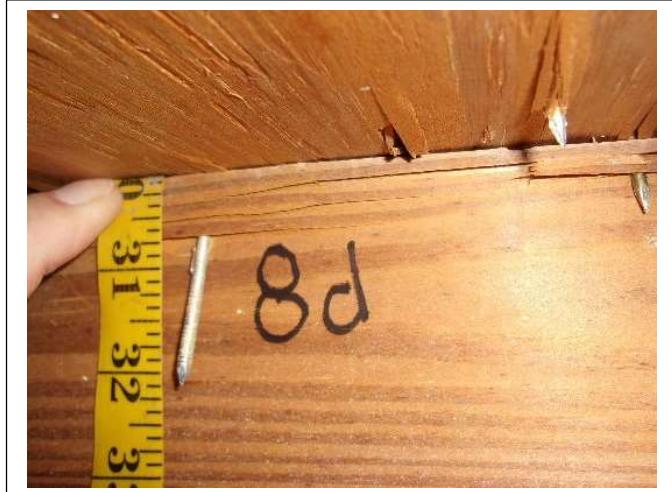

ROOF DECK ATTACHEMNT – 8d ring shank nails
installed in 2018



ROOF DECK ATTACHMENT – 8d nails within 6 inches
along the edge



ROOF DECK ATTACHMENT – 8d nails within 6 inches in
the field



R3 of Florida, LLC
P.O. Box 152205
Cape Coral, FL 33915
Office: 239.810.7793
Email: radirsas@yahoo.com



ROOF TO WALL ATTACHMENT – Properly installed
Single Wraps

ROOF TO WALL ATTACHMENT – Properly installed
Single Wraps




SECONDARY WATER BARRIER – A polymer adhesive (peel & stick) SWR Barrier was installed on the entire roof deck in 2018



OPENING PROTECTION – The window units are large missile rated.
FBC# FL239



R3 of Florida, LLC
P.O. Box 152205
Cape Coral, FL 33915
Office: 239.810.7793
Email: radirsas@yahoo.com

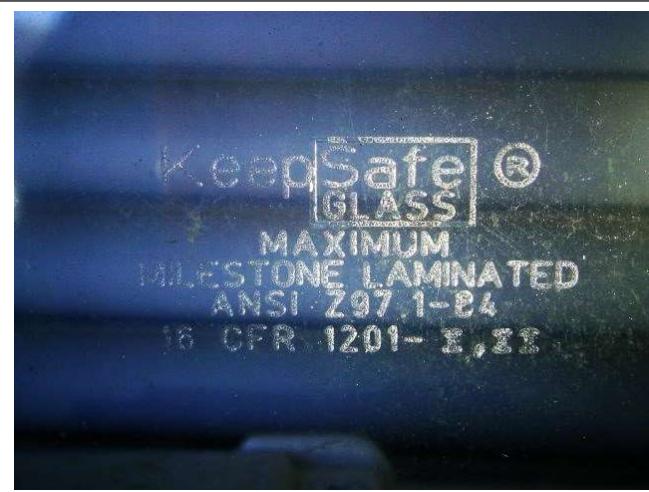

OPENING PROTECTION – The window units are large missile rated.
FBC# FL239

OPENING PROTECTION – The window units are large missile rated.
FBC# FL239



OPENING PROTECTION – The window units are large missile rated.
FBC# FL239

OPENING PROTECTION – The window units are large missile rated.
FBC# FL239



R3 of Florida, LLC
P.O. Box 152205
Cape Coral, FL 33915
Office: 239.810.7793
Email: radirsas@yahoo.com



OPENING PROTECTION – The sliding doors are large missile rated.
FBC# FL251

OPENING PROTECTION – The sliding doors are large missile rated.
FBC# FL251



OPENING PROTECTION – The hinged entry doors are large missile rated.
MDCA NOA# 06-1215.03 revised

OPENING PROTECTION – The hinged entry doors are large missile rated.
MDCA NOA# 06-1215.03 revised



R3 of Florida, LLC
P.O. Box 152205
Cape Coral, FL 33915
Office: 239.810.7793
Email: radirsas@yahoo.com



OPENING PROTECTION – The overhead garage doors are large missile rated.
FBC# FL697-R2

OPENING PROTECTION – The overhead garage doors are large missile rated.
FBC# FL697-R2



BCIS Home | Log In | User Registration | Hot Topics | Submit Surcharge | Stats & Facts | Publications | Contact Us | BCIS Site Map | Links | Se



Product Approval

USER: Public User

[Product Approval Menu](#) > [Product or Application Search](#) > [Application List](#) > **Application Detail**

► OFFICE OF THE
SECRETARY

FL #

Application Type

Code Version

Application Status

FL23089-R2

Revision

2017

Approved

*Approved by DBPR. Approvals by DBPR shall be reviewed and ratified the POC and/or the Commission if necessary.

Comments

Archived



Product Manufacturer

Address/Phone/Email

Sun-Tek Mfg

10303 General Dr

Orlando, FL 32824

(407) 859-2117

jfeudner@sun-tek.com

Authorized Signature

James Feudner
engineering@sun-tek.com

Technical Representative

Address/Phone/Email

James Feudner

10303 General Dr

Orlando, FL 32824

engineering@sun-tek.com

Quality Assurance Representative

Address/Phone/Email

James Feudner

10303 General Dr

Orlando, FL 32824

(407) 859-2117 Ext 111

engineering@sun-tek.com

Category

Sky Lights

Subcategory

Skylight

Compliance Method

Certification Mark or Listing

Certification Agency

Miami-Dade BCCO - CER

Validated By

Miami-Dade BCCO - VAL

Referenced Standard and Year (of Standard)

Standard

Year

TAS 201

1994

TAS 202

1994

TAS 203

1994

Equivalence of Product Standards

Certified By

Product Approval Method

Method 1 Option A

Date Submitted

11/26/2018

Date Validated

05/01/2019

Date Pending FBC Approval

Date Approved

05/06/2019

Summary of Products

FL #	Model, Number or Name	Description
23089.1	CMA-D	CMA-D Aluminum Skylight
	<p>Limits of Use</p> <p>Approved for use in HVHZ: Yes</p> <p>Approved for use outside HVHZ: Yes</p> <p>Impact Resistant: Yes</p> <p>Design Pressure: +60/-60</p> <p>Other:</p>	<p>Certification Agency Certificate FL23089_R2_C_CAC_CMA-D17102320.pdf</p> <p>Quality Assurance Contract Expiration Date 02/22/2021</p> <p>Installation Instructions FL23089_R2_II_CMA-D17102320.pdf</p> <p>Verified By: Miami-Dade BCCO - CER</p> <p>Created by Independent Third Party:</p> <p>Evaluation Reports</p> <p>Created by Independent Third Party:</p>
23089.2	HSF	Hurricane Self Flashing (HSF) Aluminum Skylight
	<p>Limits of Use</p> <p>Approved for use in HVHZ: Yes</p> <p>Approved for use outside HVHZ: Yes</p> <p>Impact Resistant: Yes</p> <p>Design Pressure: +60/-60</p> <p>Other:</p>	<p>Certification Agency Certificate FL23089_R2_C_CAC_HSF17102319.pdf</p> <p>Quality Assurance Contract Expiration Date 01/10/2021</p> <p>Installation Instructions FL23089_R2_II_HSF17102319.pdf</p> <p>Verified By: Miami-Dade BCCO - CER</p> <p>Created by Independent Third Party:</p> <p>Evaluation Reports</p> <p>Created by Independent Third Party:</p>
23089.3	ICMG	ICMG skylight system
	<p>Limits of Use</p> <p>Approved for use in HVHZ: Yes</p> <p>Approved for use outside HVHZ: Yes</p> <p>Impact Resistant: Yes</p> <p>Design Pressure: +80/-80</p> <p>Other:</p>	<p>Certification Agency Certificate FL23089_R2_C_CAC_ICMG18071604.pdf</p> <p>Quality Assurance Contract Expiration Date 10/10/2023</p> <p>Installation Instructions FL23089_R2_II_ICMG18071604.pdf</p> <p>Verified By: Miami-Dade BCCO - CER</p> <p>Created by Independent Third Party:</p> <p>Evaluation Reports</p> <p>Created by Independent Third Party:</p>
23089.4	ISFG	ISFG skylight system

Limits of Use

Approved for use in HVHZ: Yes
Approved for use outside HVHZ: Yes
Impact Resistant: Yes
Design Pressure: +80/-80
Other:

Certification Agency Certificate

[FL23089_R2_C_CAC_ISFG18071603.pdf](#)

Quality Assurance Contract Expiration Date

10/31/2023

Installation Instructions

[FL23089_R2_II_ISFG18071603.pdf](#)

Verified By: Miami-Dade BCCO - CER

Created by Independent Third Party:

Evaluation Reports

Created by Independent Third Party:

23089.5	MD-CMA	MD-CMA Skylight
Limits of Use Approved for use in HVHZ: Yes Approved for use outside HVHZ: Yes Impact Resistant: Yes Design Pressure: +60/-60 Other:		Certification Agency Certificate FL23089_R2_C_CAC_MDCMA17102318.pdf Quality Assurance Contract Expiration Date 03/13/2023 Installation Instructions FL23089_R2_II_MDCMA17102318.pdf Verified By: Miami-Dade BCCO - CER Created by Independent Third Party: Evaluation Reports Created by Independent Third Party:

Limits of Use

Approved for use in HVHZ: Yes
Approved for use outside HVHZ: Yes
Impact Resistant: Yes
Design Pressure: +60/-60
Other:

Certification Agency Certificate

[FL23089_R2_C_CAC_MDCMA17102318.pdf](#)

Quality Assurance Contract Expiration Date

03/13/2023

Installation Instructions

[FL23089_R2_II_MDCMA17102318.pdf](#)

Verified By: Miami-Dade BCCO - CER

Created by Independent Third Party:

Evaluation Reports

Created by Independent Third Party:

23089.6	Sun-Tek Tubular skylight	curb mounted tube skylight
Limits of Use Approved for use in HVHZ: Yes Approved for use outside HVHZ: Yes Impact Resistant: Yes Design Pressure: +65/-65 Other:		Certification Agency Certificate FL23089_R2_C_CAC_Tube18041802.pdf Quality Assurance Contract Expiration Date 05/26/2023 Installation Instructions FL23089_R2_II_Tube18041802.pdf Verified By: Miami-Dade BCCO - CER Created by Independent Third Party: Evaluation Reports Created by Independent Third Party:

Limits of Use

Approved for use in HVHZ: Yes
Approved for use outside HVHZ: Yes
Impact Resistant: Yes
Design Pressure: +65/-65
Other:

Certification Agency Certificate

[FL23089_R2_C_CAC_Tube18041802.pdf](#)

Quality Assurance Contract Expiration Date

05/26/2023

Installation Instructions

[FL23089_R2_II_Tube18041802.pdf](#)

Verified By: Miami-Dade BCCO - CER

Created by Independent Third Party:

Evaluation Reports

Created by Independent Third Party:

[Back](#)

[Next](#)

[Contact Us :: 2601 Blair Stone Road, Tallahassee FL 32399 Phone: 850-487-1824](#)

The State of Florida is an AA/EEO employer. [Copyright 2007-2013 State of Florida.](#) :: [Privacy Statement](#) :: [Accessibility Statement](#) :: [Refund Statement](#)

Under Florida law, email addresses are public records. If you do not want your e-mail address released in response to a public-records request, do not send elect

mail to this entity. Instead, contact the office by phone or by traditional mail. If you have any questions, please contact 850.487.1395. *Pursuant to Section 455.2 Florida Statutes, effective October 1, 2012, licensees licensed under Chapter 455, F.S. must provide the Department with an email address if they have one. The email provided may be used for official communication with the licensee. However email addresses are public record. If you do not wish to supply a personal address, please provide the Department with an email address which can be made available to the public. To determine if you are a licensee under Chapter 455, F.S., please click [here](#)!

Product Approval Accepts: